Operating instructions BA B1930 EN

Issue 01-2014

Work Support, Self-Locking

with pneumatic position monitoring, double acting

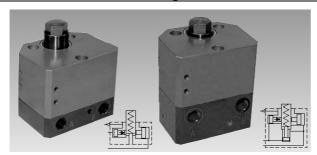


Table of contents

Description of the product	1
Validity of the documentation	1
Target group of this document	1
Symbols and signal words	2
For your safety	2
Application	2
Installation	3
Start up	6
Maintenance	7
Trouble shooting	8
Technical characteristics	8
Storage	9
Disposal	9
Declaration of manufacture	9
	Validity of the documentation Target group of this document Symbols and signal words For your safety

1 Description of the product

Hydraulic work supports are used to provide a self-adjusting rest for the workpiece during the machining operations. They compensate the workpiece surface irregularities, also deflection and vibration under machining loads.

Hydraulic locking is made together with hydraulic clamping of the workpiece, or independently.

Due to the self-locking function of the support plunger, these work supports are particularly suitable for:

- Manufacturing systems with pallet store
- Clamping fixtures with workpiece loading via handling systems
- Transfer lines
- · Automatic manufacturing systems
- Assembly lines
- · Indexing machines and
- Special machine tools.

2 Validity of the documentation

This document applies to the following products:

Work supports, self-locking of data sheet B 1.930. The following types or part numbers are concerned:

- 1931-005, -025
- 1933-005, -025
- 1935-006, -026

3 Target group of this document

 Specialists, fitters and set-up men of machines and installations with hydraulic expert knowledge.

Qualification of the personnel

Expert knowledge means that the personnel must

- be in the position to read and completely understand technical specifications such as circuit diagrams and product-specific drawing documents,
- have expert knowledge (electric, hydraulic, pneumatic knowledge, etc.) of function and design of the corresponding components.

An **expert** is somebody who has due to its professional education and experiences sufficient knowledge and is familiar with the relevant regulations so that he

- · can judge the entrusted works,
- can recognize the possible dangers,
- · can take the required measures to eliminate dangers,
- knows the acknowledged standards, rules and guidelines of the technology.
- has the required knowledge for repair and mounting.



4 Symbols and signal words

⚠ WARNING

Person damage

Stands for a possibly dangerous situation.

If it is not avoided, death or very severe injuries will result.

A CAUTION

Easy injuries / property damage

Stands for a possibly dangerous situation.

If it is not avoided, minor injuries or material damages will result.

Hazardous to the environment



The symbol stands for important information for the proper handling with materials that are hazardous to the environment.

Ignoring these notes can lead to heavy damages to the environment.

1 Note

This symbol stands for tips for users or especially useful information. This is no signal word for a dangerous or harmful situation.

5 For your safety

5.1 Basic information

The operating instructions serve for information and avoidance of dangers when installing the products into the machine as well as information and references for transport, storage and maintenance.

Only in strict compliance with these operating instructions, accidents and property damages can be avoided as well as trouble-free operation of the products can be guaranteed.

Furthermore, the consideration of the operating instructions will:

- avoid injuries
- · reduce down times and repair costs,
- increase the service life of the products.

5.2 Safety instructions

The product was manufactured in accordance with the generally accepted rules of the technology.

Observe the safety instructions and the operating instructions given in this manual, in order to avoid personal damage or material damage.

- Read these operating instructions thoroughly and completely, before you work with the product.
- Keep these operating instructions so that they are accessible to all users at any time.
- Pay attention to the current safety regulations, regulations for accident prevention and environmental protection of the country in which the product will be used.
- Use the ROEMHELD product only in perfect technical condition.
- Observe all notes on the product.
- Use only accessories and spare parts approved by the manufacturer in order to exclude danger to persons because of not suited spare parts.
- Respect the intended use.

- You only may start up the product, when it has been found that the incomplete machine or machine, in which the product shall be mounted, corresponds to the country-specific provisions, safety regulations and standards.
- Perform a risk analysis for the incomplete machine, or the machine.

Due to the interactions between the product and the machine/fixture or the environment, risks may arise that only can be determined and minimized by the user, e.g.:

- generated forces,
- generated movements,
- Influence of hydraulic and electrical control,
- etc

6 Application

6.1 Intended use

Work supports are used for industrial applications in order to protect workpieces against vibration and deflection.

Furthermore the following belongs to possible uses:

- Use within the capacity indicated in the technical data sheets.
- Use as per operating instructions.
- Compliance with service intervals.
- Qualified and trained personnel for the corresponding activities.
- Mounting of spare parts only with the same specifications as the original part.

They must only be operated with hydraulic oil.

6.2 Misapplication

⚠ WARNING

Injuries, material damages or malfunctions!

· Do not modify the product!

A CAUTION

Transverse forces

The products are not suitable to compensate side loads.

The use of these elements is not admitted:

- On pallets or machine tool tables in primary shaping and metal forming machine tools.
- If due to vibrations or other physical / chemical effects damages of the elements or seals can be caused.
- On pallets or machine tool tables that are used to change the characteristics of the material (magnetise, radiation, photochemical procedures, etc.).
- In food industry.
- · In mines.
- · In hospitals.
- Offshore or near coasts.
- In explosive and aggressive environments.
- · In the aerospace industry.
- In systems for passenger transportation.
- Single-acting elements must not be used as accumulator.
- The elements are not designed to compensate side loads.



7 Installation

⚠ WARNING

Injury by high-pressure injection (squirting out of hydraulic oil under high pressure)!

- Improper connection can lead to escapes of oil under high pressure at the connections.
- Mounting or dismounting of the element must only be made in depressurised mode of the hydraulic system.
- Connection of the hydraulic line as per DIN 3852/ISO 1179.
- Unused connections have to be locked professionally.
- Use all mounting holes.

Injury by high-pressure injection (squirting out of hydraulic oil under high pressure)!

Wear, damage of the seals, ageing and incorrect mounting of the seal kit by the operator can lead to escapes of oil under high pressure.

Before using them make a visual control.

Injury by falling parts!

- Keep hands and other parts of the body out of the working area.
- · Wear personal protection equipment!

Poisoning due to contact with hydraulic oil!

Wear, damage of the seals, ageing and incorrect mounting of the seal kit by the operator can lead to escapes of oil.

Incorrect connection can lead to escapes of oil at the ports.

- For handling with hydraulic oil consider the material safety data sheet.
- Wear protection equipment.

A CAUTION

Great weight may fall

Some product types have a considerable weight. These have to be secured against working free during transport.

Weight specifications see chapter "Technical characteristics".

Transverse forces and forced states to bolt

Side loads and forced conditions on the plunger lead to premature failure.

- · Provide external guides.
- Avoid forced conditions (overdetermination) of the plunger.
 Do not introduce any torques.

ONOTE

Vent connection

- If there is a possibility that aggressive cutting lubricants and coolants penetrate through the sintered metal air filter into the interior of single-acting products, a vent hose has to be connected and be placed in a protected position.
- It is absolutely necessary to follow the instructions for venting of the spring area see data sheet A 0.110.

7.1 Design

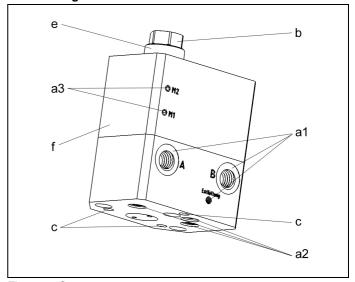


Figure 1: Components

- a1 Hydraulic ports(A extending and locking, B retracting, bleeding)
- a2 Hydraulic connection without pipes, bottom side (A extending and locking, B retracting, bleeding)
- a3 Ports for pneumatic position monitoring
- b Contact bolt
- c Fixing possibility
- e Plunger
- f Body

Versions:

Contact of the plunger by spring force

The plunger is extended in off-position.

Contact of the plunger by hydraulic pressure

The plunger is retracted in off-position. It moves forward with a light spring force against the workpiece, when hydraulic pressure is applied. With increasing oil pressure, the support plunger locks hydraulically.



7.2 Instructions for safe operation

⚠ CAUTION

Transverse forces

The products are not suitable to compensate side loads.

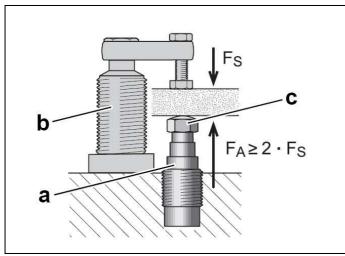


Figure 2: Principle, force flow during support

а	Work support	С	Contact bolt
b	Swing clamp		

- Design the operating pressure so that support force FA is more than twice the clamping force Fs. This reserve allows the compensation of machining forces.
- The recommended operating pressure is at least 100 bar.
- Operate the work supports only with mounted contact bolt to avoid damage of the plunger and penetration of liquids.
- Contact bolts and extensions with large weight can influence the functions of the work support.

Admissible oil flow rate

WARNING

Injury due to overload of the element

High-pressure injection (squirting out of hydraulic oil under high pressure) or flying components!

- Due to throttling or closing of ports a pressure intensification can occur.
- Connect the ports professionally!

CAUTION

Maximum flow rates do not exceed

The maximum flow rate must not be exceeded.

7.3.1 Calculation of the admissible flow rate Admissible oil flow rate

The admissible flow rate or the admissible stroke speed is valid for vertical mounting positions in combination with standard add-on parts as clamping arms or contact bolts, etc.

In case of other mounting positions and/or add-on parts the flow rate has to be reduced.

If the pump flow rate divided by the number of elements is larger than the admissible flow rate of one element, the flow rate has to be throttled.

This prevents an overload and therewith an early failure.

The flow rate can be checked as follows:

$$Q_P \le 0.06 \cdot V_Z \cdot n$$
 and/or $Q_P \le 6 \cdot v_Z \cdot A_K \cdot n$

for clamping elements and work supports (indicated on the data sheets)

Maximum piston speed

At specified pump flow rate **Q** and with the effective piston area A the piston speed can be calculated as follows:

$$v_m < \frac{Q_P}{6 \cdot A_K \cdot n}$$

Legend

 $V_{\rm Z}$ = Admissible flow rate of the element in [cm³/s]

 Q_P = Flow rate of the pump in [l/min]

 A_{κ} = Piston area in [cm²]

n= Number of elements, same dimensions

 $v_z = v_m = \text{Admissible/maximum stroke speed in [m/s]}$

ONOTE

Oil volume

- The maximum oil volume and/or the maximum stroke speed depend on the corresponding product.
 - For clamping cylinders see data sheet A 0.100.
 - or clamping elements, work supports, hydraulic valves, power units and other hydraulic elements indicated on the corresponding data sheets.

Further "things worth knowing about hydraulic cylinders, basics, detailed knowledge and calculations on hydraulic cylinders" see in the Technical library on the internet!

or download











7.3.2 Throttling of the flow rate

The throttling always has to be effected in the supply line to the swing clamp. Only thus pressure intensification and thereby pressures exceeding the operating pressure are avoided. The hydraulic circuit diagram shows flow control valves which allow oil return from the element without any impediments.

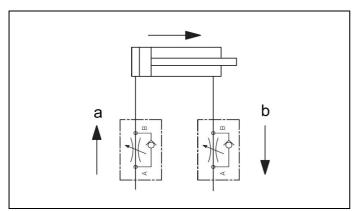


Figure 3: Hydraulic circuit diagram without flow control valves

a Throttling direction	b Free flow
------------------------	-------------

If a return-flow throttling is required due to a negative load, it must be guaranteed that the max. operating pressure (see technical characteristics) will not be exceeded.

7.4 Installation of manifold-mounted types

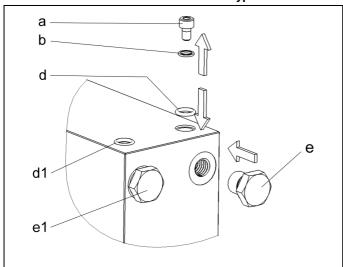


Figure 4: Example, preparation for hydraulic ports without pipes

0 NOTE

The arrangement of the ports

 The shown figure is a schematic diagram. The arrangement of the ports depends on the respective product (see chapter "Design").

- a Socket head cap screwb Sealing ring
- d O-ring (accessory, depending on the version)
- d1 Mounted O-ring
- e Screw plug (accessory)
- e1 Mounted screw plug

- 1. Drill the holes for hydraulic oil supply and return in the fixture (see also data sheet).
- Grind or finish mill the manifold-mounting surface (Ra ≥0.8 and a flatness of 0.04 mm to 100 x 100 mm, marks, scratches, shrink holes, concentric machining marks are inadmissible).

For some versions:

- 3a. Remove socket head cap screws and sealing rings, insert o-rings (accessories, if required).
- 3b. Tighten pipe ports with screw plugs (accessories, if required)
- 4. Clean the support surfaces.
- 5. Position and fasten on the fixture.
- 6. Install bleeding screws at the upper ends of the piping.

ONOTE

Tightening torques

 The tightening torques for the fixing screws have to be designed with reference to the application (e. g. as per VDI 2230).

Proposals and approximate values for the tightening torques see chapter "Technical characteristics".

7.5 Installation of pipe-mounted types

- 1. Clean the support surfaces.
- Fasten the element support at the flange surface (see figure "Mounting types").

⚠ WARNING

Injury by falling products!

Safety shoes have to be worn to avoid injuries due to falling objects.

O NOTE

Tightening

 To determine the tightening torque of the fixing screws a screw calculation as per VDI 2230 page 1 has to be effected. The screw material is indicated in the chapter "Technical characteristics".

ONOTE

Tightening torques

 The tightening torques for the fixing screws have to be designed with reference to the application (e. g. as per VDI 2230).

Proposals and approximate values for the tightening torques see chapter "Technical characteristics".



7.6 Installation of manifold-mounted types

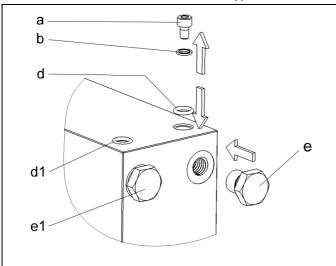


Figure 5: Example, preparation for hydraulic ports without pipes

O NOTE

The arrangement of the ports

- The shown figure is a schematic diagram. The arrangement of the ports depends on the respective product (see chapter "Design").
- a Socket head cap screw
- b Sealing ring
- d O-ring (accessory, depending on the version)
- d1 Mounted O-ring
- e Screw plug (accessory)
- e1 Mounted screw plug
- Drill the holes for hydraulic oil supply and return in the fixture (see also data sheet).
- Grind or finish mill the manifold-mounting surface (Ra ≥0.8 and a flatness of 0.04 mm to 100 x 100 mm, marks, scratches, shrink holes, concentric machining marks are inadmissible).

For some versions:

- 3a. Remove socket head cap screws and sealing rings, insert o-rings (accessories, if required).
- 3b. Tighten pipe ports with screw plugs (accessories, if required)
- 4. Clean the support surfaces.
- 5. Position and fasten on the fixture.
- 6. Install bleeding screws at the upper ends of the piping.

ONOTE

Tightening torques

 The tightening torques for the fixing screws have to be designed with reference to the application (e. g. as per VDI 2230).

Proposals and approximate values for the tightening torques see chapter "Technical characteristics".

7.7 Connection of the hydraulic equipment

 Connect hydraulic lines to qualifying standards and pay attention to scrupulous cleanness (A = Extend, B = Retract)!

ONOTE

More details

 See ROEMHELD data sheets A 0.100, F 9.300, F 9.310 and F 9.360.

Screwed Plug

 Use only fittings "screwed plug B and E" as per DIN 3852 (ISO 1179).

hydraulic connection

• Do not use sealing tape, copper rings or coned fittings.

Pressure fluids

Use hydraulic oil as per ROEMHELD data sheet A 0.100.

8 Start up

WARNING

Poisoning due to contact with hydraulic oil!

Wear, damage of the seals, ageing and incorrect mounting of the seal kit by the operator can lead to escapes of oil.

Incorrect connection can lead to escapes of oil at the ports.

- For handling with hydraulic oil consider the material safety data sheet.
- Wear protection equipment.

A CAUTION

Operating pressure should not exceed

The max. operating pressure must not be exceeded (see technical characteristics).

- 1. Check tight seat.
- Check tight seat of the hydraulic ports (check tightening torque of the hydraulic ports).
- 3. Bleed the hydraulic system.

1 NOTE

Clamping time

 Without bleeding the clamping time will be considerably prolonged and function problems may occur.

8.1 Bleeding of pipe-mounted types

- Loosen carefully at low pressure union nut of the pipe at the hydraulic ports.
- 2. Pump until bubble free oil comes out.
- 3. Fasten union nuts of the pipe.
- 4. Check tightness.

8.2 Bleeding of manifold-mounted types

- Loosen carefully the bleeding screws of the fixture at low pressure.
- 2. Pump until bubble free oil comes out.
- 3. Fasten the bleeding screws.
- 4. Check correct function.
- 5. Check sealing of the hydraulic connections!



8.3 Start up of the position monitoring

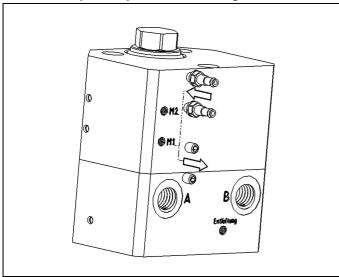


Figure 6: Design

M1 Support plunger retracted	M2 Support plunger exten-
	ded

- 1. Remove set screws M1 and M2.
- Screw in insertion nipple fitting or L-type insertion nipple fitting.

Important: Do not lock the bleeding port!

- 3. Connect pneumatic ports from the differential pressure switch to the position monitoring.
- 4. The piston position will be signalled by the pressure build up at the upper or lower pneumatic port:

Pressure build-up	Support plunger is	
Upper (M2)	extended (unclamped)	
Lower (M1)	retracted (clamped)	

The following charts show the signal course during one clamping and unclamping process:

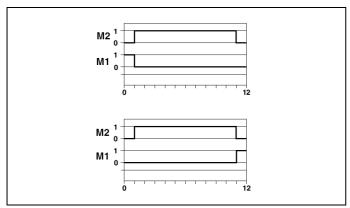


Figure 7: Signal course clamping and unclamping process

O NOTE

After realising the total stroke there will be given just no more signal at M2. So you can realise if a workpiece has been inserted or not. If a workpiece has been inserted, the clamping point is before the total stroke (M2 = 1), if no workpiece is available, the total stroke will be realised (M2 = 0).

ONOTE

Evaluation of the pneumatic pressure

- The dependence between pipe length, jet diameter, leakage, pressure and flow rate determines the measurable pressure differential. In case of a too high flow rate the pressure differential is too low.
- For the interpretation of the pneumatic pressure we recommend to use a differential pressure switch. Parallel connection of up to threer elements is possible.

Impurities in the compressed air

The pollution of the compressed air can lead to interferences in the measurement.

9 Maintenance

⚠ WARNING

Burning due to hot surface!

- In operating conditions, surface temperatures of more than 70 °C can appear at the product.
- All maintenance and repair works must only be effected in cooled mode or with safety gloves.

A CAUTION

All work by service personnel only!

All works only to be effected by ROEMHELD service staff.

9.1 Cleaning

A CAUTION

Avoid damages of the moved components

Avoid damages of the moved components (rods, plungers, bolts, etc.) as well as of wiper and seal.

The product must be cleaned at regular intervals, especially the area of the piston or the plunger housing has to be cleaned from swarf and other liquids.

9.2 Regular checks

- 1. Check tightness of hydraulic connections (visual control).
- Check running surfaces (of the piston rod or bolt) if there are marks and scratches. Traces of marks can be an indication for a contaminated hydraulic system or an inadmissible side load of the block cylinder.
- 3. Leakage check at the housing piston rod, bolt or flange.
- 4. Clamping force control by pressure control.
- 5. Check if the maintenance intervals are kept.



9.3 Maintenance intervals

A CAUTION

All work by service personnel only!

· All works only to be effected by ROEMHELD service staff.

If a high availability has to be guaranteed, we recommend a preventive maintenance to be effected by ROEMHELD experts after 100,000 cycles.

O NOTE

Exceeding of the load cycle can lead to a reduction of the load force or a failure of the element!

The exchange of the seal kit has to be made in case of external leakages. If a high availability has to be guaranteed, we recommend to change the seals at the latest after 1,000,000 cycles or 2 years.

The seal kit must be changed by ROEMHELD experts.

10 Trouble shooting

Trouble	Cause	Remedy	
	Oil flow rate too high	Reduce oil flow rate	
Plunger does not	Inner parts corro- ded	Repair required by ROEMHELD	
extend	Penetration of cooling liquids	Repair required by ROEMHELD	
	Broken spring	Repair required by ROEMHELD	
DI.	Inner parts corro- ded	Repair required by ROEMHELD	
Plunger does not retract	Penetration of cooling liquids	Repair required by ROEMHELD	
Tetract	Broken return spring	Repair required by ROEMHELD	
	Operating pressure not sufficient	Check the dimensioning of the operating pressure as per catalogue	
		Adjust the operating pressure correspondingly	
Plunger moves back		Check dimensioning of the load	
	Load (clamping and machining force) too high	Adjust the operating pressure correspondingly	
		Use other elements (work support/swing clamp)	

11 Technical characteristics

General characteristics

Types	Maximum operating pressure	Adm. load force
	[bar]	[kN]
1931-0X5	500	8.0
1933-0X5	500	20.0
1935-006	400	40.0

Weights

Types	Stroke [mm]	Weight [kg]
1931-005	8	1.8
1931-025	8	1.4
1933-005	12	3.5
1933-025	12	2.8
1935-006	20	15.3
1935-026	20	12.3

Proposal, tightening torques for screws of tensile strength 8.8, 10.9, 12.9

ONOTE

The indicated values are approximate values and have to be interpreted according to the user's application!

See note!

Thread	Tightening torque [Nm]		
	8.8	10.9	12.9
M6	10	15	18
M8	25	36	45
M10	49	72	84
M12	85	125	145
M14	135	200	235
M16	210	310	365
M20	425	610	710
M24	730	1050	1220
M30	1,450	2100	2450

Note: Valid for workpieces and set screws made of steel with metric thread and connecting surface dimensions as per DIN 912, 931, 933, 934 / ISO 4762, 4014, 4017, 4032

In the table values for tightening torques the following is considered:

Design steel/steel, friction value μ ges = 0.14 - not oiled, utilisation of the minimum yield point = 90%.

ONOTE

Further information

• For further technical data see ROEMHELD data sheet.



12 Storage

A CAUTION

Storage of components!

- The product may not be exposed to direct solar radiation, because the UV light can destroy the seals.
- A storage differing from the storage conditions is inadmissible
- In case of improper storage, the seals can embrittle and resinification of the anti-corrosive oil or corrosion at the element can occur.

The elements are tested by default with mineral oil. The exterior of the elements is treated with a corrosion inhibitor.

The oil film remaining after the test provides for a six-month interior corrosion protection, if stored in dry and uniformly tempered rooms.

For longer storage times, the element has to be filled with a non-resinifying corrosion inhibitor and the outside surfaces must be treated.

13 Disposal



Hazardous to the environment

Due to possible environmental pollution, the individual components must be disposed only by an authorised expert company.

The individual materials have to be disposed as per the existing regulations and directives as well as the environmental conditions.

Special attention has to be drawn to the disposal of components with residual portions of hydraulic fluids. The instructions for the disposal at the material safety data sheet have to be considered.

For the disposal of electrical and electronic components (e.g. stroke measuring systems, proximity switches, etc.) country-specific legal regulations and specifications have to be kept.

14 Declaration of manufacture

Manufacturer

Römheld GmbH Friedrichshütte Römheldstraße 1-5 35321 Laubach, Germany Tel.: +49 (0) 64 05 / 89-0 Fax: +49 (0) 64 05 / 89-211

E-mail: info@roemheld.de www.roemheld.com

Declaration of manufacture of the products

Work supports, self-locking of data sheet B 1.930. The following types or part numbers are concerned:

- 1931-005, -025
- 1933-005, -025
- 1935-006, -026

They are designed and manufactured in line with the relevant versions of the directives **2006/42/EC** (EC MSRL) and in compliance with the valid technical rules and standards. In accordance with EC-MSRL and EN 982, these products are components that are not yet ready for use and are exclusively designed for the installation in a machine, a fixture or a plant.

According to the pressure equipment directives the products are not to be classified as pressure reservoirs but as hydraulic placing devices, since pressure is not the essential factor for the design, but the strength, the inherent stability and solidity with regard to static or dynamic operating stress.

The products may only be put into operation after it was assessed that the incomplete machine/machine, in which the product shall be installed, corresponds to the machinery directives (2006/42/EC).

The manufacturer commits to transmit the special documents of the products to state authorities on request.

The technical documentation as per appendix VII part B was prepared for the products.

Responsible person for the documentation: Dipl.-Ing. (FH) Jürgen Niesner, Tel.: +49(0)6405 89-0.

Römheld GmbH Friedrichshütte

Laubach, 09.01.2014